

ISSUE:

Some 2005 model year Chevy and GMC full size vans have been produced with large amounts of caulking in their roof gutters. This situation occurs when the bolts supplied, with the model numbers listed to the right, are too short as the caulk gap between the stand and mounting bracket increases. Both the new "Universal Clamp" and the "GM" style clamps are affected.

SOLUTION:

Using the longer bolts supplied in this kit, place the round 1/4" thick spacers between the gutter clamp and the ladder rack base. This will compensate for the thickness of the caulking in the gutter. In extreme cases, a portion of the caulk might have to be cut out of the gutter and then re-caulked after the rack is installed.

GUTTER CLAMP SPACER KIT

Model Numbers Affected:

Quick Clamp: 234-3, 236-3, 233-3.



All-Purpose Aluminum (White):

209-3, 219-3, 229-3, 2095-3, 2097-3.

All-Purpose Aluminum (Clear):

211, 213, 2136.

Safari Rack: 210-3.

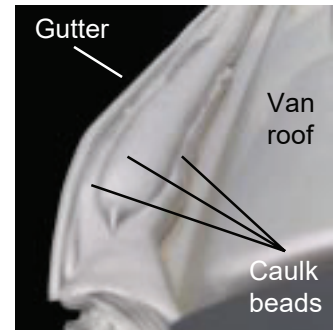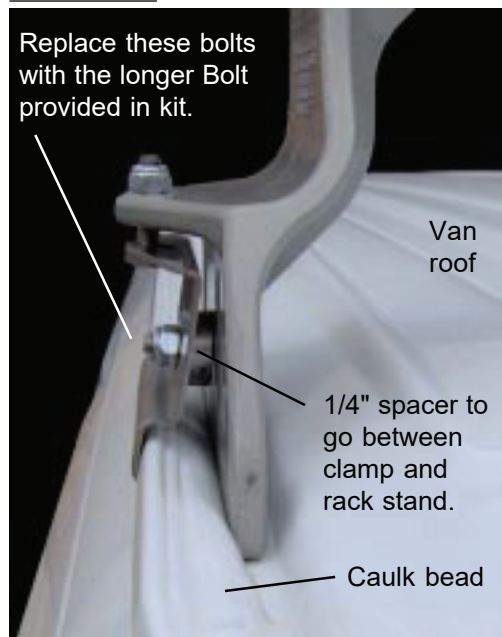

Mounting Kit #32-0134

Used on Models:

**234-3, 236-3, 233-3, 209-3, 219-3,
229-3, 2095-3, 2097-3, 210-3**

Quantity	Description
4 ea.	5/16-18 x 1-1/4" Carr. Bolt
4 ea.	1/4" Spacer

Mounting Kit #32-0135

Used on Models:

211, 213, 2136

Quantity	Description
2 ea.	5/16-18 x 1-1/2" Hex. Hd. Bolt
2 ea.	1/4" Spacer

Depending on the intallation, multiples of this kit may be needed. Extra hardware could be left over after installation is complete.



**Industrial
Products®**

Industrial Products

5717 Salmen Street New Orleans, LA 70123
Phone: 504-734-1315 Email: sales@industrialproducts.com